

CoverTec Products

Key Steps to applying NanoPrime and CoverShield CTS200

Stripping Cleaning

Pick-up the stripping or cleaning solution with a wet vacuum, automatic scrubber or clean mop. Rinse with freshwater and allow floor to dry thoroughly prior to applying any NanoPrime.

Priming and Coating

- Nano Prime the floor:
 - Stir container for 1 minute to make sure all contents are evenly dispersed
 - Pour a little NanoPrime on the floor and saturate micro pad
 - Pour a thin line of NanoPrime material onto the floor
 - Spread THIN and EVEN 1st coat. It will dry quickly. Do NOT OVER-APPLY or OVER-WORK
 - Work in small areas
 - Let dry for 5- 10 minutes
 - Burnish (minimum 2000 RPM) 1st coat with a WHITE POLISHING PAD
 - Apply 2nd coat using same techniques as above. Will use even less product
 - Let dry for 5 -10 minutes
 - Burnish 2nd coat with a WHITE POLISHING PAD
- Apply CoverShield CTS200
 - Dust mop floor
 - Pour a little CTS200 on the floor and saturate micro pad
 - Por a line of CTS200 material onto the floor
 - 1st Coat - Working in SMALL AREAS – 4' x 5' and spread with micro pad
 - THE TRICK IS TO SPREAD THE PRODUCT **THIN AND EVENLY** WITH THE MICROPAD. DO NOT KEEP WIPING OVER IT. IT GOES DOWN **THIN** AND DRIES FAST SO IF YOU OVER WORK IT YOU WILL GET STREAKS. REMEMBER WORK IN SMALL AREAS
 - Wait 5-10 minutes and then burnish 1st coat. . Use an AQUA PAD. Remember do not over burnish. Walk burnisher slowly over the area.
 - 2nd Coat – Apply same as 1st coat above
 - Wait 5-10 minutes and then burnish 2nd coat. Use an AQUA PAD. Remember do not over burnish. Walk burnisher slowly over the area.
 - YOU ARE DONE!